

SERVICE - INFO




LuK Nr: 128 0055 11 – 280mm DBVR

Bulletin 988 2000 960

CASE IH, MANITOU, VOLVO**

Info:	128 0055 11 replaces / ersetzt / remplace / sustituye a / sostituisce 128 0055 40 + 128 0055 41
(GB)	Please ensure that the flywheel is machined to a pot depth of 36.6mm.
(D)	Das Schwungrad ist auf eine Tiefe von 36.6mm auszdrehen,siehe unten.
(F)	Veuillez vous assurer que le volant-moteur est rectifié à une profondeur de 36.6mm.
(E)	Asegúrese de que el volante está mecanizado hasta una profundidad de 36.6mm.
(I)	Controllare che il volano venga rettificato a una profondità di 36.6mm.
LuK Repsets:	628 1032 07 = 128 0055 11 + 328 0175 42 + 500 1046 50 + 410 0026 00 628 1032 09 = 128 0055 11 + 328 0175 42 628 1033 07 = 128 0055 11 + 328 0175 41 + 500 1046 50 + 410 0026 00 628 1033 09 = 128 0055 11 + 328 0175 41 628 2590 07 = 128 0055 11 + 328 0175 40 + 500 1046 50 + 410 0026 00 628 2590 09 = 128 0055 11 + 328 0175 40 628 2592 07 = 128 0055 11 + 328 0175 10 + 500 1046 50 + 410 0026 00 628 2592 09 = 128 0055 11 + 328 0175 10
	128 0055 11 – 128 0055 12 + 434 0342 10

For model information please see LuK Catalogue / Die genaue Fahrzeugzuordnung entnehmen Sie bitte dem LuK-Katalog / Pour les informations le modèle veuillez consulter le catalogue LuK / Para obtener información sobre el modelo, rogamos consulte el catálogo de LuK / Per informazioni sul modello consultare il catalogo LuK

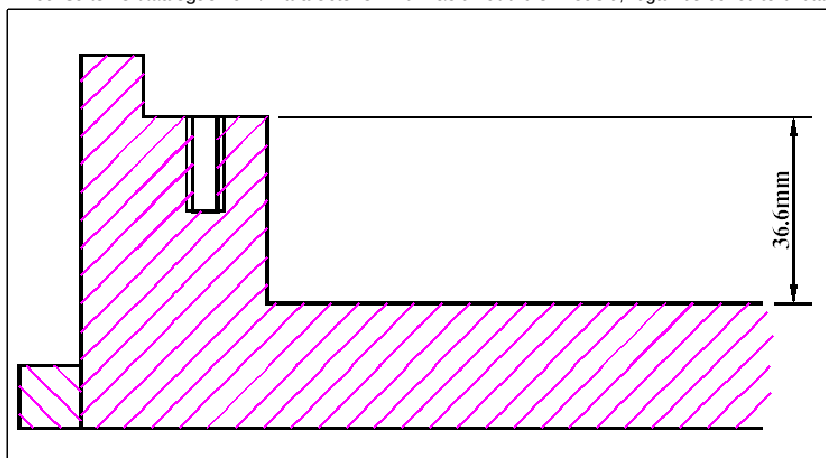

**Flywheel
Schwungrad
Volant-moteur
Volante-motor
Volano**

Info:	Fig 2 replaces / ersetzt / remplace / sustituye a / sostituisce Fig 1
-------	---



Fig 1



Fig 2

OPTIONAL / WAHLWEISE / OPTIONNEL / OPCIONAL / OPTIONAL

Info:	Fig 4 replaces / ersetzt / remplace / sustituye a / sostituisce Fig 3
-------	---



Fig 3

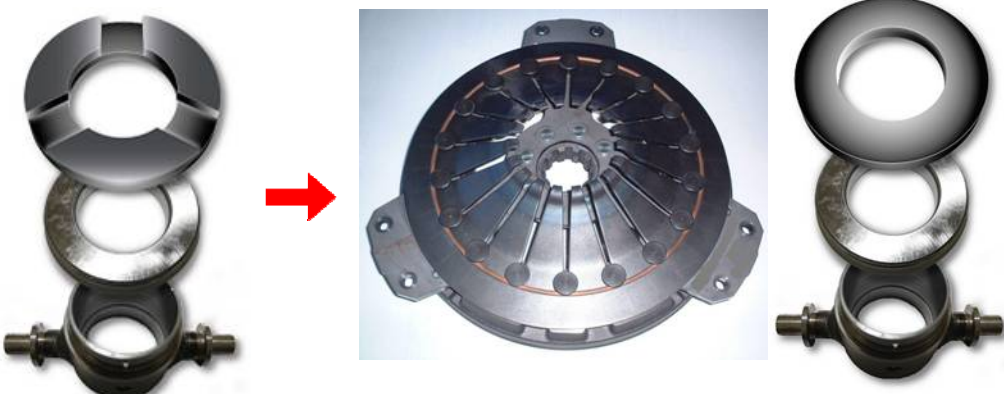


Fig 4

Issue Level 4